DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection

Bay Area Branch 690 Walnut Ave.St. 150 Vallejo, CA 94592-1133 (707) 649-5453 (707) 649-5493



Contract #: 04-0120F4

Cty: SF/ALA Rte: 80 PM: 13.2/13.9

File #: 69.28

WELDING INSPECTION REPORT

Resident Engineer: Siegenthaler, Peter **Report No:** WIR-018235 Address: 333 Burma Road **Date Inspected:** 22-Nov-2010

City: Oakland, CA 94607

OSM Arrival Time: 700 **Project Name:** SAS Superstructure **OSM Departure Time:** 1900 **Prime Contractor:** American Bridge/Fluor Enterprises, a JV

Contractor: Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China

CWI Name: Xu Tao **CWI Present:** Yes No **Inspected CWI report:** Yes N/A **Rod Oven in Use:** Yes No No N/A N/A N/A **Electrode to specification:** Yes No **Weld Procedures Followed:** Yes No N/A N/A **Qualified Welders:** Yes No **Verified Joint Fit-up:** Yes No N/A Yes No N/A **Approved Drawings:** Yes No **Approved WPS: Delayed / Cancelled:** Yes No N/A

34-0006 **Bridge No: Component: OBG** Components

Summary of Items Observed:

On this date Caltrans OSM Quality Assurance (QA) Inspector, Hiranch Patel, was present during the times noted above for observations relative to the work being performed.

Bike Path-DCP

- -During random DCP check, this QA inspector observed out of flatness across the weld exceed the allowable tolerance.
- -The component is Bike Path bottom cover plate, seam weld.
- -The thickness of the bottom plate is 6mm.
- -According to the Standard Specification 1999, Section 55, flatness of the splice weld is measured by 600mm straight edge and the allowable tolerance is 5mm.
- -Maximum out of flatness was observed as 7mm~7.5mm on bike path BK004A-005, weld#BK004A2-005-018.

For further information, please find attached pictures

Blast Shop

This QA inspector performed UT of approximately 10% of the area previously tested and accepted by ZPMC Quality Control personnel. This QA Inspector generated an UT report for this date. The member is identified as OBG Components. The weld designations reviewed are as follows:

-(BK006A1-002-009)


Unless otherwise noted, all observed on this date appeared to generally comply with applicable contract

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

documents.



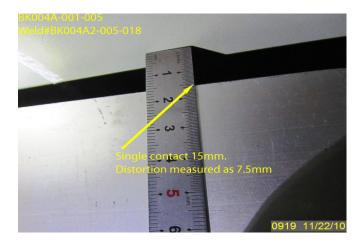

Summary of Conversations:

No relevant conversations.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang 150-0042-2372, who represents the Office of Structural Materials for your project.

Inspected By:	Patel, Hiranch	Quality Assurance Inspector
Reviewed By:	McClendon, Timothy	QA Reviewer